



Trust the Midas touch.

Midas Auto & Tire
618 Lake St
Nelson, BC V1L 4C8
+1 250-354-4866
www.midas.com

Date **11/17/2021**
Customer **Beth Piorecky**
Repair Order **211117007**

Vehicle **2018 Toyota Sienna**
License Plate **BC KJ713E**
Odometer **44,998 km**
VIN **5TDDZ3DCXJS209337**

Digital Midas Touch Vehicle Inspection



Priority Recommendations

Inspection Point

Finding/Recommendations

Cost: If ignored, these items can lead to additional repairs

Cabin Air Filter



*** The cabin Filter is what cleans the air that you breathe inside the car. It can contain mold, mildew and debris. This can degrade the air quality in the cabin of the vehicle.

Dirty

Finding: Damaged / Restricted / Dirty causing contaminated air inside vehicle

Recommendation: Replace immediately to maintain clean air quality

Maintenance: These items are recommended to increase the life of your vehicle and to lower the cost of ownership

Left Front Tire Condition

4 /32nds



Inner shoulder wear

Finding: Tire is below 5/32's wear Yellow

Recommendation: Budget for tire replacement soon

Left Rear Tire Condition

5 /32nds



Winters 13/32" all

Finding: Tire is below 5/32's wear YELLOW

Recommendation: Budget for tire replacement soon

Right Rear Tire Condition

5 /32nds



Winter tires 13/32" all



Finding: Tire is below 5/32's wear YELLOW

Recommendation: Budget for tire replacement soon

Inspection Point		Finding/Recommendations	
Right Front Tire Condition	4 /32nds	✗	<p>Inner shoulder wear, casing showing</p> <p>Finding: Tire is below 5/32's wear YELLOW</p> <p>Recommendation: Budget for tire replacement soon</p>





Midas Courtesy Check 1		Finding/Recommendations
Is the License Plate Registration Current?	Yes	✓
Are All Dash Warning Lights Off?	Yes	✓
Are All Exterior Lights Working?	Yes	✓
Horn Working OK?	Yes	✓
Wipers		✓
Hood/Hatch supports		✓
Engine Air Filter		✓
Battery/Cables		✓

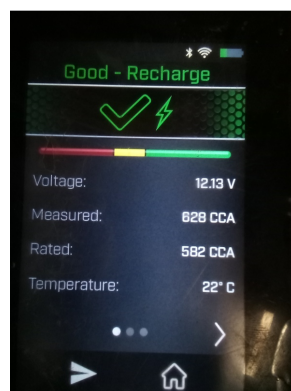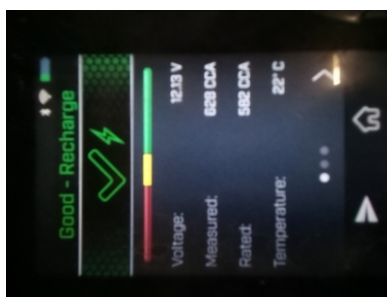

Cooling System Hoses		✓
Belts (Except Timing Belt)		✓
Midas Courtesy Check 2		Finding/Recommendations
Oil Condition prior to Oil Service?		✓
Transmission Fluid Level / Condition		✓
Coolant Level / Condition		✓
Brake Fluid Level / Condition	1 % water	✓
Steering System		✓

Shocks and Struts		✓	
Exhaust System		✓	
Brake symptoms observed		✓	All pads 5-6 mm
Driveline		✓	
Spark Plugs		✓	
Timing Belt		✓	
Fluid Leaks	Yes	✓	
Midas Courtesy Check 3		Finding/Recommendations	
Left Front Tire Pressure	36 psi	✓	
Left Rear Tire Pressure	36 psi	✓	
Right Rear Tire Pressure	36 psi	✓	
Right Front Tire Pressure	36 psi	✓	
Wheel alignment ok?	No	✗	Front tires showing inner shoulder wear.



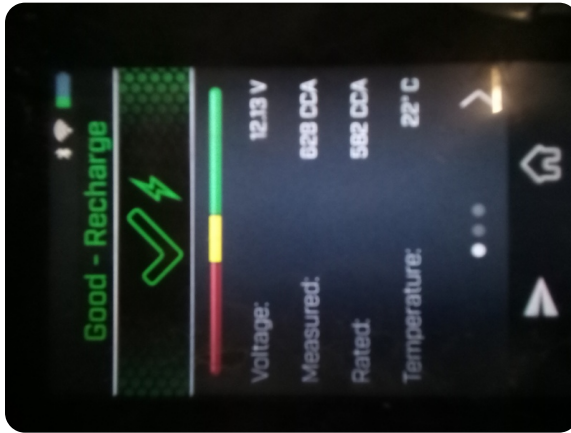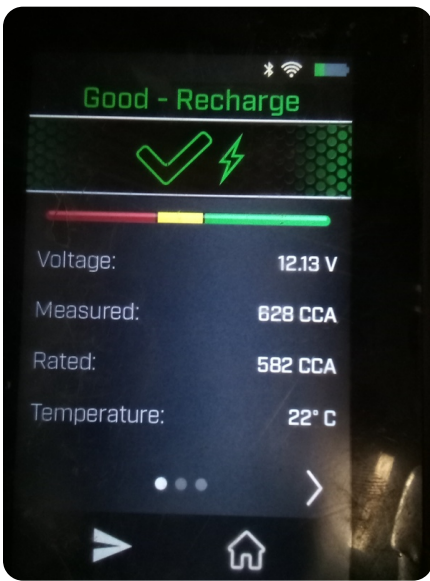

Adam Marks, A Certified Technician has completed this inspection; it reflects the vehicle's condition on this day and does not imply a warranty on the items checked. This inspection should only be used as an aid. This inspection does not mean that there were no other problems, but only what we noticed or what appeared at the time of inspection. Certain items may need further inspection to determine the extent of damage and cost.